


# Read Me

## Pro Tools HD 10.1.1 on Mac OS X 10.6.x (“Snow Leopard”) and 10.7.x (“Lion”)

This Read Me documents important compatibility information and known issues for Pro Tools and Pro Tools HD 10.1.1 software on computers running Mac OS X and 10.6.x (“Snow Leopard”) and 10.7.x (“Lion”).

 *Pro Tools HD systems with HDX hardware acceleration require Mac OS X 10.7.x (“Lion”)*

---

### Compatibility

Avid can only assure compatibility and provide support for qualified hardware and software configurations.



*For the latest compatibility information—including qualified computers, operating systems, and third-party products—visit the Avid website ([www.avid.com/compatibility](http://www.avid.com/compatibility)).*

### All Pro Tools Systems

#### **An iLok must be connected at all times while running Pro Tools**

Pro Tools requires that an iLok with the appropriate authorizations be connected to the computer at all times. Do not remove the iLok while running Pro Tools. If the iLok is removed while Pro Tools is running, one of the following will occur:

Pro Tools shows a dialog giving you the following choices:

- Reinsert the iLok and click Save. Pro Tools saves the session and then quits.
- Click Quit. Pro Tools closes the session without saving and then quits.

– or –

Pro Tools displays a dialog giving you the following choices:

- Reinsert the iLok and click OK to continue working in Pro Tools.
- Click Cancel. Pro Tools closes the session without saving and then quits.

#### **Mixer and Elastic Audio plug-ins from lower versions of Pro Tools are not compatible with Pro Tools 10 (PTSW-136983)**

The Mixer and Elastic Audio Plug-ins from lower versions of Pro Tools are not compatible with Pro Tools 10.x. If you encounter an error indicating that these plug-ins are corrupted please re-run the Pro Tools 10 installer to ensure that the correct plug-ins are installed.

#### **Pro Tools cannot record to drives formatted as Case-Sensitive (PTSW-64502)**

Pro Tools cannot record to Mac OS X drives which have been formatted as “Case-Sensitive.” Format the Mac OS X record volumes as “Mac OS X Extended (Journaled)” in order to record properly.

#### **Spotlight indexing can interfere with long record passes (97151)**

There are known incompatibilities with Spotlight indexing drives while recording audio. If you will be recording to a large number of tracks for over an hour, set all of your drives to private in the Mac OS X System Preferences to ensure maximum performance. Failure to do this may result in Pro Tools reporting an error and ending the record pass when Spotlight indexes the drives.

## Mac OS X 10.7.x keyboard shortcuts for Mission Control conflict with Pro Tools keyboard shortcuts

By default, Mac OS X 10.7.x uses Control + Arrow Up and Arrow Down keys to open Mission Control and Application Windows. These keyboard shortcuts conflict with the Pro Tools keyboard shortcuts for changing track display height. You can disable or reassign these shortcuts in Mac OS X.

### To disable or reassign keyboard shortcuts in Mac OS X:

- 1 From the Apple menu, choose System Preferences.
- 2 Click Keyboard.
- 3 Click the Keyboard Shortcuts tab.
- 4 Disable or reassign the shortcut for Mission Control.

## In Mac OS X 10.7.x, the Library folder in each User folder is now hidden

DigiTrace logs, which can be helpful in troubleshooting Pro Tools errors, are stored in User/Library. These logs will be more difficult to find if the Library folder is hidden.

### To find the Library folder:


- Go to the Finder and click the Go menu while holding the Option key. Library will appear in the menu while the Option key is held.

### To display all hidden files and folders in an Open dialog:

- Press Command+Shift.

### To permanently unhide the Library folder:

- 1 Launch Terminal.
- 2 Type: `chflags nohidden /Users/<Username>/Library.`

 *The hide status of the Library folder may be reset during an OS update.*

## Pro Tools menus and interface are grayed out on launch (PTSW-18024)

Pro Tools can appear unresponsive at launch, with the Menus grayed out and browsers inoperable. This can happen because of Spaces. If Pro Tools is launched in any other Space than the first one, the Session Quick Start dialog still opens in the first Space. You can temporarily disable Spaces, launch Pro Tools, and disable the Session Quick Start dialog in the Preferences to avoid this problem.

## Automatic Update Notification will not connect through a proxy server that requires authentication (108837)

Software Updater will not find an active internet connection when behind a proxy server that requires authentication to gain internet access. To work around this, the client machine with Software Updater needs to be moved out from behind the proxy or the proxy needs to allow HTTP access via port 80 without requiring authentication.

## Ethernet control surfaces may be unable to communicate with Pro Tools when Parallels Desktop for Mac is installed (101232)

If you use an Ethernet control surface (such as C|24) or work surface (such as D-Control or D-Command) with Pro Tools, Parallels Desktop for Mac may prevent communication with the surface. Uninstall Parallels for your computer to restore communication.

## HDX Hardware Accelerated Systems

### **Some Mac Pro computers with certain video cards may not have power connections available for HDX cards (PTSW-156651)**

Some video cards require power from the motherboard, which is also a requirement for Avid HDX cards. If you have a video card that requires both power connections on the motherboard, a power connection for your HDX cards will not be available. To avoid this problem, use a video card that does not require more than one power connection to the motherboard.

### **In Avid DigiTest, the reported slot number may not correspond to the physical slot number in the computer (PTSW-155373)**

In Avid DigiTest, the slot number reported for Avid HDX cards starts from 0 on up. For example, “Slot 1” does not necessarily correlate to the first physical slot in the machine. If you have an Avid HDX card that is having problems, match the Serial Number ID on the back of the card with the Serial Number ID displayed on the Slot Info page in Avid DigiTest.

## Pro Tools|HD Systems

### **Slot order for BlackMagic Design DeckLink Extreme II PCIe card and Pro Tools|HD PCIe cards (106661)**

BlackMagic Design recommends placing the DeckLink Extreme II video playback and capture card in Slot 3 of your PCIe Macintosh. You may have difficulty placing the HDMI daughter card in an unused slot between slots 0 and 1 in your Power Mac computer due to the full size of Pro Tools HD cards. In order to accommodate an additional Pro Tools|HD Accel card, the DeckLink Extreme II was extensively tested in PCIe slot 1 as well. No decrease in performance was found.

## HD Native Systems

### **With Mac OS 10.6.8 or 10.7.x, it may not be possible to update the firmware on HD Native card (PTSW-146374)**

When launching Pro Tools HD with a HD Native card on Mac OS 10.6.8 or 10.7.x, a -1164 error may occur. This error indicates that the firmware for the HD Native card cannot be updated from version 1.0 to version 1.02 or 1.03. If this error occurs, you can only update the firmware using Mac OS X 10.6.7 or lower. The firmware update can also fail when using a Thunderbolt MacBook Pro. To avoid this error, use a Mac without Thunderbolt or use the Avid NativeCardFlasher utility to update the HD Native firmware,



*For more information on updating Native card firmware, refer to the following Avid Knowledge Base articles:*

<http://avid.custkb.com/avid/app/selfservice/search.jsp?DocId=419331>

<http://avid.custkb.com/avid/app/selfservice/search.jsp?DocId=429831>

### **HD Native card should be installed in PCIe slot 3 or slot 4 of Woodcrest and Clovertown Mac Pro computers for optimum performance (PTSW-1771)**

Clovertown and Woodcrest Mac computers cannot support a PCIe device of speed greater than 1x in PCIe Slot 2 without PCIe Slot 1 being lowered to 8x. (Note that Avid does not test graphics cards at less than their ideal speed of 16x.) To avoid this problem, install your Pro Tools Native card in PCIe slot 3 or slot 4 of your Clovertown or Woodcrest era Mac computer.

### **Clovertown Mac Pro computers do not have the PCIe bandwidth required to use more than two 4x PCIe cards at full speed (PTSW-1657 and PTSW-1456)**

Clovertown Mac Pro computers with an ATTO UL5D card, a BlackMagic Design's Decklink 3 Video Capture card, and an HD Native card do not have the PCIe Bandwidth required to run all three cards at full speed. In this configuration, three 4x PCIe cards are being called for, while Clovertown Mac Pro computers can only accommodate two 4x cards and one 1x card. Consequently, one card must be run at less than full speed. Avid has not tested any down-throttled combinations and as such this is an unsupported configuration. Consider the following options as workarounds: slow down the built in graphics card to 8x or remove the SCSI HBA card and use SATA instead of SCSI drives.

Similarly, an HD Native card, an ATTO Celerity ES-41 Fiber Optic Network Adapter card, and a BlackMagic Design's DeckLink 3 card cannot be combined in Clowertown era Mac Pro without one card being used at less than its optimal PCIe bandwidth. Since Pro Tools support for Unity MediaNet 5 is limited to push/pull scenarios, Avid recommends that the ATTO Celerity card be down-throttled by installing it in the 1x PCIe slot, and that the HD Native and DeckLink 3 cards be installed in the 4x PCIe slots.

Avid strongly recommends against running the HD Native card or BlackMagic Design DeckLink 3 card at less than full speed.

## **VENUE 2.9.x systems with two HDx Option Cards may not be recognized by Pro Tools HD Native systems (PTSW-142834)**

If a second HDx Option card is installed in a VENUE 2.9.x system, it may cause both HDx cards not to be recognized by Pro Tools on HD Native. A single VENUE HDx Option card is recognized properly by Pro Tools on HD Native, so for consistent performance it may be necessary to de-install the second HDx card.

---

## **Issues Resolved in Pro Tools 10.1.1**

*Note: Some issues resolved in Pro Tools 10.0.1 (for all Pro Tools systems), were not resolved in Pro Tools 10.1 (for HDX systems), but have been resolved in Pro Tools 10.1.1 (for all Pro Tools systems). For details, see “Issues Resolved in Pro Tools 10.0.1” below.*

### **Issues where audio output was lost under certain conditions have been resolved. (PTSW-157510)**

**On Pro Tools HD systems with HDX hardware acceleration, QuickPunch recordings no longer have a small amount of distortion at the punch in point. (PTSW-157165)**

**Automation is now correctly adjusted by Delay Compensation under certain conditions. (PTSW-15289, PTSW-157293, PTSW-157308, PTSW-157315)**

Delay Compensation now correctly adjusts automation data under conditions where it was subject to over- or under-compensation, such as when reading plug-in parameter automation, writing automation in Latch mode, modifying automation in Trim mode, bouncing audio to an internal bus, or re-recording output of a cascaded send.

**Sample-level waveform editing with the Pencil tool is now correctly scaled by Clip Gain. (PTSW-156301)**

**Snap to Grid with Slip mode now functions correctly. (PTSW-132934)**

When editing in Slip mode with Snap to Grid enabled, editing behavior is now correct: selections are constrained to the grid but edits are not.

**Pressing an Edit Mode keyboard shortcut (F1-F4) simultaneously with a Tool shortcut (F5-F10) no longer incorrectly engages the Smart Tool. The Smart Tool is only engaged when pressing combinations of the F6-F8 shortcuts. (PSTW-144679)**

**The Edit mode switches on D-Control, D-Command, and C|24 now behave correctly. (PTSW-155524)**

**On TDM systems, using the Surround Mixer in certain cases at high sample rates no longer causes a -7100 error. (PTSW-157805, PTSW-155362)**

**General improvements with Satellite and LTC chase when Disk Cache is in use. (PTSW-157894)**

**When trimming a clip from the right, automation breakpoints at the right-hand boundary of a clip are now correctly preserved. (PTSW-138656)**

**Volume automation written using the on-screen fader or a EUCON-compatible control surface now ramps smoothly between automation breakpoints. (PTSW-153164)**

Using these methods to write automation previously would result in a large number of “stairsteps” in the written automation.

**Using large disk caches (16 GB or more) no longer causes -9516 errors. (PTSW-158058)**

**AAX DSP plug-ins that are inactive on an Aux track are no longer incorrectly converted to Native mode. (PTSW-158084)**

**The AAX version of Reverb One now produces a decay time that is correct at high sample rates. Previously, it was producing half the indicated decay time. (PTSW-158279)**

**Mod Delay III Sync to Tempo now correctly syncs to the current session tempo. (PTSW-157140)**

**Opening some AAX plug-ins (such as Mod Delay III) no longer causes them to start writing unwanted automation. (PTSW-157135)**

**- 9073 errors after performing long record passes and then immediately playing or recording again have been eliminated. (PTSW-156999)**

In lower versions of Pro Tools, this problem can be avoided by making sure Pause During Playback is enabled from the Task Manager window.

**Volume automation now imports correctly from Media Composer 5 and 6. (PTSW-154723)**

**Read-only volumes can now be used as external search locations. (PTSW-154032)**

**DigiTest no longer quits unexpectedly or incorrectly reports test failures when running on a Pro Tools HD system with HDX cards. (PTSW-157735)**

**The shortcut to Structure patches no longer gets corrupted when running a Pro Tools updater after installing the Pro Tools Instrument Expansion Pack. (PTSW-157905)**

---

## Issues Resolved in Pro Tools 10.0.1

**Pro Tools no longer quits unexpectedly when starting playback before the Timeline Cache completes caching. (PTSW-153586)**

**Pro Tools no longer quits unexpectedly when bus recording with Elastic Audio enabled. (PTSW-155752)**

**Pro Tools no longer quits unexpectedly when dragging a clip from a Tick-based track with volume automation to a new track. (PTSW-154591)**

**Pro Tools no longer posts 9092, 9093, or 9094 errors in certain unwarranted situations, such as when pressing play after opening a session or when previewing audio from a CD in the Import Audio dialog. (PTSW-142270, PTSW-151706, PTSW-155295, PTSW-156006, PTSW-156280)**

Note that 9092, 9093 and 9094 errors can still occur when a system is being run under demanding loads, including small buffer settings on non-DSP based systems. In these cases, enabling Playback Error Suppression can allow you to continue, at the possible expense of sound quality. There are also known cases of plug-ins causing these types of errors. You can determine if a plug-in is at fault by removing plug-ins one type at a time until the problem goes away. Then create a new session with just that plug-in to see if the errors occur there. If they do, please report this to Avid and also to the manufacturer of the plug-in. Reporting to both will help get the problem solved more quickly.

**Audio now plays consistently from Elastic Audio clips after copying them in the timeline. (PTSW-154636)**

**Clip Gain on Elastic Audio clips now plays correctly. (PTSW-154529)**

**Bus recording audio with clip gain applied no longer results in unintended artifacts being recorded. (PTSW-156129)**

**Plug-In types are now correctly converted when moving sessions between an HDX system and a non-HDX system. (PTSW-151142)**

When opening a session from an HDX system on a non-HDX system. DSP plug-ins convert to Native plug-ins if they are available. If the same session is re-opened on an HDX session, the original choices of which plug-ins were DSP and which were Native will be reinstated.

**Pressing an Edit Mode keyboard shortcut (F1-F4) simultaneously with a Tool shortcut (F5-F10) no longer incorrectly engages the Smart Tool. The Smart Tool is only engaged when pressing combinations of the F6-F8 shortcuts. (PSTW-144679)**

**When recording audio stems from audio tracks that use Send outputs, printed audio on destination tracks with outputs set to "none" is now properly time-aligned. (PTSW-157440)**

**Tracks not selected when using the Export Selected Tracks as New Session command no longer appear in the Import Session Data dialog. (PTSW-157391)**

Any sessions created in Pro Tools 10.0 using the Export Selected Tracks as New Session command will still show all the original session's tracks in the Import Session Data dialog. To avoid this, either use the Export Selected Tracks as New Session command with Pro Tools 10.0.1 or 10.1.1 to create a new session, or change the track order in the session and save it in 10.0.1 or 10.1.1.

**Bypass and Mute automation are now adjusted correctly in a track when a clip is deleted. (PTSW-153154)**

**Plug-in automation is now copied correctly between multi-mono and multi-channel versions of the same plug-in. (PTSW-138658)**

**The transport now performs reliably when using 9-pin Machine Control combined with Satellites and Video Satellite. (PTSW-151352, PTSW-142368, PTSW-142320, PTSW-152790, PTSW-151212, PTSW-151201, PTSW-151196)**

**Under 9-pin control, the Shuttle function now operates at the correct speeds. (PTSW-156102)**

**Pro Tools now plays in sync while in Remote Mode. (PTSW-154477)**

**Pro Tools now locks correctly while in Remote Mode when controlled from a deck via Sound Master ION. (PTSW-157335)**

**Satellite sync now operates reliably in Destructive Punch mode when systems are controlled from 9-pin devices and commands are issued shortly after transport starts. (PTSW-147702)**

**When Transport = Machine, after using FF/REW more than once, subsequent transport commands now work correctly. (PTSW-153962, PTSW-157855)**

**Pro Tools now remains responsive after you change the computer name in the Mac OS X hostconfig file (as recommended in the *System 5 and Pro Tools Guide*) and then disconnect the computer from the Internet. (PTSW-154157)**

**Pro Tools now correctly imports files from a Mix and Matched Media Composer session.(PTSW-152018)**

**After consolidating from source files during AAF import, Original Time Stamps are now correctly compensated, preserving field recorder matches. (PTSW-136563)**

**The Import Rendered Audio FX in Import Session Data setting is now correctly enabled by default. (PTSW-146809)**

**You can now drag a file directly to a Field Recorder Guide Track without disabling the Field Recorder Guide Track setting. (PTSW-152913)**

**Field recorder files that cross midnight now correctly match other field recorder files with time stamps after midnight. (PTSW-152334)**

**Pro Tools with Avid Interplay now allows you to enter up to 99 characters (the previous limit was 31 characters) in the Set Tape ID dialog. (PTSW-152814)**

**Pro Tools with Interplay now posts a warning to prevent overwriting a sequence when using Send to Playback. (PTSW-152023)**

When doing a Send to Playback with Interplay, if a sequence with the same Tape ID already exists on the playback server, Pro Tools now posts a warning dialog that allows you to edit the tape ID or cancel the command, preventing accidental overwriting of the sequence.

**If a sequence is given a Tape ID by an Avid video editor, the Set Tape ID dialog in Pro Tools now defaults to that Tape ID when doing a Send to Playback via Interplay. (PTSW-154098)**

**On Mac OS X 10.7.x (Lion), installing the Pro Tools Instrument Expansion Pack after installing Pro Tools now correctly installs the plug-ins. (PTSW-152505)**


If you install the Pro Tools Instrument Expansion Pack (PTIEP) before installing Pro Tools on a system running Mac OS X 10.7.x (Lion), no plug-ins will appear in the Pro Tools inserts menu. To avoid this, install Pro Tools first, then install the PTIEP. If you installed the PTIEP first, you must uninstall both Pro Tools and the PTIEP, then reinstall Pro Tools first, followed by the PTIEP.

**The Pro Tools 10.0.1 installer correctly moves previously installed Pro Tools Instrument Expansion Pack (PTIEP) content to the new Applications/Avid folder instead of deleting it. (PTSW-153599)**

---

## Known Issues

The following section documents known issues you may encounter when using Pro Tools Pro Tools HD 10.1, along with work-arounds if they exist.

 *For known issues specific to any of the software options for Pro Tools HD, see the [Satellite Link Read Me](#), the [Video Satellite Read Me](#), or the [Video Satellite LE Read Me](#).*

## General Pro Tools Issues

### **Synchronizing to External Clock with a Different Sample Rate from the Session Results in the Following Error: “The current playback engine does not support a sample rate of 44.1 kHz” (PTSW-127065)**

In certain circumstances, attempting to synchronize to an external clock that has a different sample rate than the session may result in the following error: “The current playback engine does not support a sample rate of 44.1 kHz.” On Mac OS X, this may be preceded by the error “Pro Tools has re-set the sample rate of the HW device because it was changed by another application.” If this happens, correct the sample rate mismatch and re-select the correct clock rate.

### **Templates Retain I/O Settings and Some Preferences, Display Settings, and Window Layouts (PTSW-47133)**

Pro Tools Session Templates Retain the I/O settings and some of the preferences, display settings, and window layouts from the system on which the template was created. Consequently, created a new session based on a template restores several session properties from the original system. These properties are retained by Pro Tools until you change them or another session or template is opened that replaces them. This also means that if a new blank session is created after using a template, the properties from the template will be used for the new session.

The properties retained from templates include default track height, view settings, window size and position, and I/O Setup. You can update templates by making the desired changes, using the File > Save as Template command (be sure to select the “Install template in system” option), and then selecting the template you want to replace.

### **With Mac OS X 10.7.x (“Lion”), the Send To DigiDelivery command in Pro Tools requires a beta version of DigiDelivery.**

The latest production version of the DigiDelivery client application is not compatible Mac OS X 10.7.x (“Lion”). A beta version of the DigiDelivery client is available for users of Mac OS X 10.7.x. Although it has not been through a full qualification test effort, there are no known issues with this version.

### **CPU Usage Limit May Be Reached when Error Suppression is Enabled (PTSW-50339)**

When enabling Error Suppression at CPU Usage Limit 85% or higher, it may be possible to overload your computer to a point at which it is no longer recoverable. To avoid this state, keep your CPU Usage Limit set to 80% or lower when Error Suppression is enabled.

### **Screen Redraw May Slow Down at Higher CPU Usage Limit Settings when Host Engine Error Suppression is On (82915)**

In some cases, you may experience a slowdown in screen redraw or background CPU tasks when Host Engine Error Suppression is engaged and the CPU Usage Limit is set to 85 percent or above. If you encounter this behavior while using Error Suppression, open the Playback Engine Dialog and lower the CPU Usage Limit by 5 to 10 percent.

### **Opening Session Created with Pro Tools 7.4 or Lower (106746)**

When opening sessions created with Pro Tools 7.4 or lower in Pro Tools 8.1 and higher, all waveform overviews are recalculated. This is because Pro Tools now features 16-bit waveform overviews, so all old 8-bit overviews will need to be recalculated. This recalculation only needs to happen once.

### **Save Session Copy to Session Formats Lower than Pro Tools 10 Converts All Audio for Sessions with Interleaved Files (PTSW-152737)**

When saving a Pro Tools 10.x session that has a mix of interleaved and non-interleaved (multi-mono) audio files to a lower session format (such as Pro Tools 7–9 “.ptf”), all audio files are converted (even if they are not interleaved).

### **Clip Groups can be Dragged to Tracks in Playlist View Even Through Clip Groups are not Supported in Playlist View (PTSW-152707)**

It is possible to drag a clip group to a track in Playlist view even though clip groups are not supported in Playlist view. Normally, when switching to Playlist view from another track view, any clip groups on that track are automatically ungrouped. While clip groups dragged to tracks in Playlist view may appear to work properly, it is recommended that you ungroup them while in Playlist view to ensure proper behavior.

### **Automation is Replaced Instead of Overlaid when Using Adjust Session Start Time to Match Source Start Time when Importing Session Data (PTSW-149273)**

Automation can sometimes be replaced instead of overlaid when using Adjust Session Start Time to Match Source Start Time when importing session data. This issue may occur if the source session start time (of the session being imported) is earlier than the current session start time. This issue can be avoided if you instead import the session data from the session with the later start time into the session with the earlier start time. You must also not enable the Adjust Session Start Time to Match Source Start Time option, and select Maintain Absolute when prompted.

### **Automation Window Update when Writing Automation (PTSW-46747)**

When writing automation on Volume, Pan, and so on, the corresponding buttons in the Automation window provide no indication that automation on the related control is being written. You will need to observe the automation buttons on tracks in Mix or Edit windows to see an indication that automation is being written.

### **Automatic Delay Compensation cannot not be applied to tracks recording from different types of sources (PTSW-157960)**

Automatic Delay Compensation cannot compensate for cascaded records that use both I/O and bus inputs to recording tracks. An example of this is feeding an audio track (in record) from an audio input, and then bussing the output of the track to another audio track also in record. The first audio track will be compensated but the second cascaded track will not be. (This is not a common workflow.)

### **Scrubbing Audio is offset by the overall system delay when Automatic Delay Compensation is enabled (PTSW-150138)**

With Automation Delay Compensation enabled, when scrubbing audio the output is offset by the overall system delay (displayed in the Session Setup Window). Large system delays cause a noticeable offset. To avoid this issue, you can disable Automatic Delay Compensation when you want to scrub audio for editing.

### **When Delay Compensation is enabled and System Delay is very large, DestructivePunch may not create a proper crossfade at the punch-in or punch-out point (PTSW-157282 )**

This issue has existed since Pro Tools 7.2. With Pro Tools 10 and an increased delay compensation value, this may be more noticeable. In the rare cases where this occurs, retry the pass using DestructivePunch.

### **Possible Performance Issues with Waveform Overviews (110041, 106801, and 106577)**

Calculating waveform overviews in Pro Tools 8.1 and higher may cause some one-time issues with various operations. Once the overviews are calculated, system performance will return to normal. Areas where you may notice this are:

- Legacy Sessions (110041)—When opening Legacy Pro Tools sessions (lower than 8.0) for the first time, if you immediately start playback, you may encounter various errors advising you to increase the H/W Buffer size, or to delete tracks, or to remove some Native (RTAS and AAX) plug-ins. This is because Pro Tools is re-calculating waveform overviews in the background. Pausing this task in task manager, or waiting until this task is complete, will resolve the issue. Once the waveform is calculated, you will not experience this issue again.
- Playback of Newly Created Clips (106801 and 106577)—You may notice a slight drop in normal playback performance immediately following a record take or after creating or importing new clips. This is because Pro Tools is calculating waveform overviews in the background. This issue is usually encountered when recording or creating many clips with long durations. Pausing this task in task manager, or waiting until this task is complete, will resolve the issue. Once the waveform is calculated, session playback performance returns to expected levels.
- With Pro Tools 10.1.1 and higher, waveform overview calculation is automatically paused whenever the Transport is engaged. You do not need to manually pause this task in the Task Manager unless you want all tasks paused (such as relinking).



### **Waveform overviews disappear after editing metadata from the Workspace browser (PTSW-153258)**

If you edit metadata from the Workspace browser, audio waveform overviews may disappear from the Edit window. If this occurs, recalculate the waveforms or close and reopen the session. To avoid this issue, edit metadata from the Project browser instead of the Workspace browser.

### **–9128 or –6031 DAE Errors when Using Sibelius 7 as a ReWire Client with Pro Tools (PTSW-148554 and PTSW-149809)**

If you encounter –9128 or –6031 DAE Errors when using Sibelius 7 as a ReWire client with Pro Tools, try increasing the Hardware Buffer Size to 1024 samples in the Pro Tools Playback Engine (Setup > Playback Engine).

### **Audio Clips on Tick-Based Tracks Do Not Play at the Correct Tempo after Opening a Reason Song with a Different Tempo (PTSW-34086)**

Audio clips on tick-based tracks do not play at the correct tempo after opening a Reason song with a tempo that is different from the one in your session. To correct this, make any tempo change via the Conductor track or the Manual Tempo input and the clips will play back correctly.

### **Cannot Run Reason or Record as ReWire Clients if They Have Not First Been Launched and Set Up as a Standalone Application (PTSW-133070)**

Reason and Record need to be launched and setup as a stand-alone applications before running them as a ReWire clients with Pro Tools. Do the following:

- Launch Reason or Record in stand-alone mode and follow the on-screen instructions.
- Quit Reason or Record.
- Launch Pro Tools and insert Reason or Record as a ReWire plug-in on an audio, Auxiliary Input, or Instrument track.

### **Exporting Interleaved BWF Files from Pro Tools 10 and Importing into Pro Tools 9.0.x and Lower May Cause Pro Tools to Quit Unexpectedly (PTSW-151579)**

When exporting any greater-than-stereo multichannel interleaved WAV (BWF) files other than 5.1 from Pro Tools 10 and then importing them into Pro Tools 9.x or lower, Pro Tools quits unexpectedly. To avoid this problem, export audio files for import into lower versions of Pro Tools in another file format (such as AIFF or multi-mono).

### **Opening a Session with a QuickTime Movie as a Non-Administrator User Can Prevent the Movie from Playing Back (47053)**

If you open a session as a non-administrator user and you do not have permissions for the QuickTime movie file, Pro Tools will tell you that the movie file cannot be found and prompt you to relink. In the relink window the movie can be found and Pro Tools will *appear* to relink to it but it will still not play back. For correct playback, make sure you have permission to use the QuickTime movie file.

### **Some QuickTime Audio Formats Cannot Be Imported (58792 and PTSW-52226)**

The audio from QuickTime movies with Apple Lossless or AMR audio compression cannot be imported into Pro Tools. Use QuickTime Pro or another application to convert the audio to another format prior to import.

### **Apple Lossless Codec Is Not Supported for Bounce to QuickTime Movie (PTSW-53198)**

Pro Tools 7.3 and higher does not support the Apple Lossless audio codec. Choosing it from the Bounce to QuickTime Movie Audio Compression dialog will result in a movie without usable audio.

### **48 kHz Bounce to MP3 in Pro Tools 7.x and Higher Results in a 44.1 kHz MP3 File (72617)**

Bouncing to MP3 while using the “Highest Quality Encoding, Slower Encoding Time” setting with any bit rate other than 320 kbps will result in a 44.1 kHz file. This is a known limitation of the encoder.

### **Changing the Genre Setting for the ID3 Tag Info when Bouncing to MP3 Results in an Error Message (PTSW-152856)**

When bouncing to MP3, changing the Genre Info on the ID3 Tag more than once results in an error message. To resolve this issue, close the error message, then close the MP3 window, and then click Bounce again.

### **Hourly –9073 Errors During Recording (PTSW-132654)**

If you encounter –9073 disk errors at the same time every hour while recording in sessions with large track counts, you may need to update Mac OS. To avoid this problem, check and install all OS related security updates through Mac Software Update.

### **With the Pro Tools Web Browser, Links to External Sites Do Not Work as Expected (PTSW-145325)**

In the Pro Tools Web browser, navigating to external sites using links from Avid web pages (such as links to social networks like Facebook and LinkedIn) may not work as expected. For the sake of security, the Pro Tools Web browser is restricted to avid.com pages. If you want to browse sites other than avid.com, or share avid.com pages with friends, use the Launch Page in External Browser feature to view the page in your default Web browser and navigate from there.

## HDX Hardware Accelerated Systems

### **Pro Tools does not play back when an invalid sync source is selected on SYNC HD (Word Clock or AES/EBU) (PTSW-156651)**

When attempting to initiate playback, playback will fail if a SYNC HD is connected to an HDX card and an Avid audio interface with no connections to either the word clock or AES/EBU ports. Ensure that the clock is set to a working clock source to resolve this issue.

### **Pro Tools does not use HDX hardware if a Core Audio application is using HDX hardware (PTSW-155010)**

When launching Pro Tools HD on an HDX hardware accelerated system, Pro Tools will use the Pro Tools Aggregate I/O as the Playback Engine if a Core Audio application has already engaged the HDX hardware. Be sure to quit all Core Audio applications before launching Pro Tools HD to ensure that Pro Tools HD can use HDX hardware.

### **With multiple track output assignments, Native AAX plug-ins use more voices than expected (PTSW-156089)**

When using Native RTAS or AAX plug-in as the last insert on a track that has multiple outputs assigned, additional voices will be used for each voiced output assignment. This is because a voice is required for each audio channel routed from the TDM engine to the host processor and back. To avoid this issue, use a DSP AAX plug-in, such Trim, as the last insert on the track.

### **On Avid HDX systems, noise occurs at the end of a loop during Loop Playback of audio (PTSW-158582)**

On HDX systems, when certain plug-ins are present on a track, loop playback of audio will create distorted noise at the end of the loop. As a workaround, remove problematic plug-ins from the track.

### **Some audio channels may not sound when using Virtual Soundcheck with VENUE and Pro Tools HD with Avid HDX Hardware (PTSW-155085)**

Some channels may not sound from Pro Tools HD with HDX hardware when playing back using VENUE with the HDx option during Virtual Soundcheck. This only occurs if you switch to Virtual Soundcheck when Pro Tools is running. To avoid this issue, switch to Virtual Soundcheck on VENUE before launching Pro Tools. If you do encounter this issue, quit and relaunch Pro Tools to correct the problem.

## Pro Tools|HD Systems

### **Unable to Open Sessions Created with Pro Tools 7.4 or Lower that Use the Maximum Available DSP in Pro Tools 8.1 and Higher (111490)**

Since the surround mixer plug-in is installed by default with Pro Tools 8.1 and higher, some stereo sessions that use mono output paths may use a different DSP allocation than in Pro Tools 7.4 and lower. Older sessions that use mono output paths *and* use all of the available DSP and may not open in Pro Tools 8.1 or higher. The workaround is to remove the surround mixer plug-in from the “Plug-Ins” folder and move it to the “Plug-ins (Unused)” folder so Pro Tools does not use the surround mixer to build your mixer. This should make the necessary DSP available to open the session.

## HD Native Systems

### **Audible Pops and Clicks when Changing Buffer Sizes (PTSW-125715)**

Pops and clicks may occur when changing the Hardware Buffer Size (H/W Buffer Size) in the Playback Engine dialog while monitoring live audio through HD Native hardware. Avid recommends not changing the Hardware Buffer Size while monitoring live audio to avoid this problem. If you must change the Hardware Buffer Size while monitoring live audio, be sure to lower the monitoring volume to avoid any possible damage to your speakers.

## I/O Setup

### **Session Templates Retain I/O Settings and Some Preferences, Display Settings, and Window Layouts (111605)**

Pro Tools Session Templates retain the I/O settings and some of the preferences, display settings, and window layouts from the system on which the template was created. Consequently, creating a new session based on a template restores several session properties from the original system. These properties are retained by Pro Tools until you change them or another session or template is opened that replaces them. This also means that if a new blank session is created after using a template, the properties from the template will be used for the new session.

The properties retained from templates include default track height, view settings, window size and position, and I/O Setup. You can update templates by making the desired changes, using the File > Save as Template command (be sure to select the “Install template in system” option), and then selecting the template you want to replace.

### **Master Faders Assigned to Mapped Output Busses Function Only on that Specific Bus, Not for the Output Channel as a Whole (PTSW-127517)**

Because a Master Fader works on a bus, not on an output path or output channel, there may be certain configurations in which the level sent to the physical I/O is not reflected on any meters in the Pro Tools application. If the configuration includes overlapping output paths or has multiple busses assigned to a single output path, the overall signal level from these combined sources (including any clipping indication) will only be displayed on the interface itself. You can avoid using multiple output paths or output busses simultaneously by routing your sources to a single mapped output bus and assign a Master Fader to that.

### **Overlapping Outputs Are Not Supported for AFL/PFL (PTSW-128167)**

While Pro Tools I/O Setup lets you select overlapping outputs for AFL/PFL monitoring, overlapping outputs are not supported for AFL/PFL monitoring. For example, if paths A 3–4 overlap the main path A 1–2, even though you can select paths A 3–4 for AFL/PFL monitoring, you won’t hear anything when monitoring AFL/PFL on paths A 3–4. You can avoid this problem by using non-overlapping paths for AFL/PFL monitoring.

### **Output and Send Assignments May Not Reactivated if They Are Disabled and Then Re-enabled in the IO Setup when DSP Usage is at its Maximum (PTSW-156397)**

Disabling and re-enabling an internal or mapped bus in the IO Setup does not guarantee that all associated assignments will be re-activated in a session that is using maximum DSP resources. To re-activate these assignments, save and reopen the session. You can also avoid this issue by adding additional HDX cards to your system.

## File and Disk Management

### **Missing Files when Opening a Session that Was Saved Using Save Copy In with Preserve Folder Hierarchy (PTSW-52860)**

The Preserve Folder Hierarchy feature is designed so that sessions with media split between multiple volumes can be easily moved between systems while retaining folder hierarchy. In order for media files to be automatically found, manually copy or create a folder at the root level of each volume with the session name that contains the Audio Files or Video Files folder. Or, manually relink to the missing files at their current location.

### **Session Copy Saved with Preserve Folder Hierarchy in which Multiple Files Have the Same Name Does Not Relink Properly (PTSW-29069)**

When saving a session copy with Preserve Folder Hierarchy checked, files with the same name may not relink properly when using Manual Relink. When opening the session copy, use Automatically Relink to locate the correct files. If the session has already been opened using Manual Relink and some files are still offline, select Relink Offline in the Project Browser to manually relink the remaining files.

## Elastic Audio

### **When Opening Legacy Sessions (Pro Tools 9 and Lower) in Pro Tools 10, Any Rendered Elastic Audio Clips Are Automatically Re-rendered (PTSW-139989)**

Rendered Elastic Audio clips created in legacy sessions need to be re-rendered for use in Pro Tools 10. Re-render of these files occurs automatically when the session is opened in Pro Tools 10.

### **Fades on Elastic Audio-Enabled Tracks May Not Regenerate when Opening Sessions Created with Pro Tools 10 in Pro Tools 9.0.x (PTSW-152949)**

When saving a copy of a Pro Tools 10 session to v7-v9 and opening the copy in Pro Tools 9.x, some fades might not be regenerated even if you select the option to re-generate fades without searching. If this happens, closing and re-opening the session causes the missing fades to regenerate.

### **Certain Audio Files Cannot Be Calculated or Cleared of Elastic Analysis in Workspace Browser (PTSW-29622)**

There are some rare cases where a file will have a file suffix of a file format supported by Elastic Audio (either .WAV or .AIF), but the Pro Tools Workspace Browser will not allow calculation or clearing of elastic analysis. The browser menu items Calculate Elastic Analysis and Clear Elastic Analysis will be greyed out. In these cases, the file may actually be in a non-supported format. To check the file's format, look at the Format column in the Workspace browser. If a file format other than WAV or AIFF is shown (such as QuickTime), then the file cannot be calculated or cleared of elastic analysis. Note that these non-supported files can still be previewed in tempo, as well as elasticized once imported into a session.

### **Tempo Maps Made from Bar|Beat Marker Generation in Beat Detective Cause Clip Groups in Rendered Mode to Fall Offline (PTSW-34950)**

A tempo map made from Bar|Beat Marker Generation in Beat Detective will cause clip groups in Rendered mode to fall offline. The workaround is to make an edit to the offline clip and then toggle the Elastic Audio from rendered to real-time and then back to rendered.

### **Maintaining Phase Coherency with Elastic Audio Pitch Processing (PTSW-20602)**

When there is Elastic Audio Pitch processing enabled on a track, switching from Polyphonic, Rhythmic, or X-Form to Monophonic or Varispeed can disrupt phase coherency. To preserve phase coherency in this case, be sure to clear all Elastic Audio Pitch processing from the track before switching to the Monophonic or Varispeed algorithm.

### **Drift in an Audio File May Occur when Using Elastic Audio and the Monophonic or X-Form Algorithms (PTSW-33768)**

Drift in an audio clip may occur when using elastic audio depending on how much the clips is expanded or compressed when using the Monophonic or X-Form algorithms. If you are using elastic audio with material that contains transient information in it that you would like to keep from drifting, you should use the Polyphonic or Rhythmic algorithms.

### **Default Input Gain Preference Is Only for Elastic Audio Imported at Session Tempo (PTSW-34096)**

The Default Input Gain preference in the Elastic Audio section of the Processing Preferences page is for Elastic Audio Imported at Session Tempo only. This preference option will not function unless Preview in Context is enabled in Workspace, and/or "Drag and Drop from Desktop Conforms To Session Tempo" is enabled in the Processing Preferences page.

### **Displayed Timebase is Incorrect after Importing Elastic Audio Tracks (PTSW-46897)**

The incorrect timebase is displayed after importing Elastic Audio tracks to existing tracks with opposite timebase. You will need to manually select the correct timebase for the affected tracks.

### **Elastic Audio Clips on Playlist Lanes Are Not Rendered (PTSW-47311)**

In Playlists View, any Elastic Audio clips on Playlist lanes are not rendered (waveform is “off-line”) when changing the track’s Elastic Audio processing from Real-Time to Rendered.

### **Clip Groups Containing Elastic Audio Are Not Recognized as Elastic if the Clip Group Itself Has Not Had Any Elastic Functions Applied (PTSW-34335)**

If a clip group contains Elastic Audio inside it, but no Elastic Audio operations have been performed on the outermost level of the clip group itself, then the clip group will not register as Elastic Audio. When used to create a new track, the track will not automatically be Elastic Audio-enabled, and the elastic audio inside the clip group will be rendered using the default Elastic Audio plug-in for the session. As a workaround, add a warp marker to the clip group to force it to register as an elastic clip. Or, create an Elastic Audio-enabled track first, then add the clip group to it.

### **Cannot Import Elastic Audio Tracks with the Consolidate From Source Media Option (PTSW-33894)**

Use Copy from Source Media to import Elastic Audio tracks.

### **Timing Inaccuracy in Audio Files Converted from CAF and MP3 with Preview In Context Enabled (PTSW-46707)**

Audio files converted from CAF and MP3 with Preview In Context enabled can cause timing inaccuracies (gaps in the audio and inner-clip asynchronous transients issues). This is inherent with compressed file formats.

## MIDI


### **When Recording MIDI, Wait for Note Does Not Respond to MIDI Input from ReWire (PTSW-30511 and PTSW-34550)**

When performing a MIDI record, Wait for Note will not respond to any MIDI received from ReWire. If you are recording MIDI generated from a ReWire application, you will have to start the transport manually or use a countoff instead of Wait for Note.

### **When Using Import Session Data on a MIDI Track with Real-Time Properties Enabled and Set to Using Diatonic Transposition, Transposition is Based on the First Key Signature in the Session Only (PTSW-49297)**

When importing session data from a session that includes multiple key signatures and a MIDI or Instrument track with the “Transpose in Key” Real-Time property enabled, the transposition will be based only on the first key in the session. This can be corrected by toggling the Real-Time Properties off and on; then the diatonic transposition will be correct for each key.

## Plug-Ins

 *For known issues about specific plug-ins, see the Audio Plug-Ins Read Me.*

### **On HDX systems, certain plug-ins may produce unexpected bursts of noise (PTSW-159680)**

On Pro Tools HD systems with HDX hardware acceleration, plug-ins such as the ReVibe 2 AAX DSP plug-in may generate unexpected noise on rare occasions. Removing plug-ins on the affected track may resolve the issue.

### **The TDM version of Dyn III Expander/Gate may experience fidelity or routing issues in 192 kHz sessions (PTSW-159677)**

Using the TDM version of the Dynamics III Expander/Gate plug-in at 192kHz can cause unexpected behavior, including distortion of processed audio and unintended routing of audio between tracks using the Expander/Gate plug-in. If this occurs, try quitting and relaunching Pro Tools, or using the RTAS version of the Dynamics III Expander/Gate plug-in.

### **When opening legacy sessions on HDX systems, the 4-band EQ III plug-in is converted to the 7-band EQ III plug-in**

The AAX EQ III plug-in does not have a 4-band option. Pro Tools will automatically convert 4-band EQ III instances into 7-band instances if you are using only AAX plug-ins. If the EQ3.dpm is present in the Plug-ins folder, then the plug-in will be converted to a Native (RTAS) version.

### **The EQ III 4-band plug-in is displayed above the 1-band and 7-band version in Pro Tools 10.1.1**

Avid shortened the name of the new AAX version of EQ III to allow for better visibility of the plug-in name in Narrow Mix view as well as on control surfaces. The (.dpm) TDM and RTAS version name is “EQ III or EQ 3” (with space) whereas the (.aaxplugin) DSP and Native version is “EQIII or EQ3” (without space).

As a result of this change, when viewing the Native plug-in pop-up menu, EQ 3 4-band (RTAS) will be displayed before the EQ3 1-band and EQ3 7-band (Native) plug-ins.

#### **TDM plug-ins cannot be converted to Native AAX format in under certain conditions (PTSW-158652)**

TDM plug-ins instantiated in a session cannot be converted to Native AAX version if there is no RTAS equivalent of the plug-in and there are no other Native AAX versions already present in the session. Reverb One is an example of such a plug-in. To avoid this, instantiate a Native AAX version of the plug-in on a spare track, then convert the TDM plug-in to Native format.

#### **On Mac OS X 10.7.x (“Lion”), Any Custom Location for Avid Virtual Instrument Content is not Remembered**

When installing Avid Virtual Instruments, if you choose a custom location for the content, that location is not remembered, resulting in error messages when you try to use a virtual instrument plug-in (Boom, Mini Grand, or Xpand) that references a “.big” content file. The location is not remembered after quitting and relaunching Pro Tools.

To avoid this error, move or reinstall the Avid Virtual Instrument content to the default location in the Applications > Avid folder.

#### **Some Plug-ins Require Exclusive Use a DSP Chip on HDX Hardware Accelerated Systems (PTSW-154614)**

Certain plug-ins, such as ReVibe and Reverb One, use direct memory access (DMA) on Avid HDX cards. DMA plug-ins cannot share HDX DSP chips with other plug-ins. Additionally, even though DMA plug-ins of the same type can share a single HDX DSP chip (for example, multiple ReVibe plug-ins can use the same HDX DSP chip), they must be of the same channel width (DMA plug-ins of the same type cannot share the same HDX DSP chip if they have different channel widths).

#### **HD Pack, Massive Pack, Mbox Factory, and 003 Factory Plug-in Bundle installers do not work on Pro Tools 9.0 or higher (PTSW-134351)**

If you install Pro Tools 9.0 or higher on a clean Pro Tools system, and then run HD Pack, Mbox Factory, or 003 Factory plug-in installers included with lower versions of Pro Tools (such as Pro Tools 8.0.4), they will not be able to install the bundled plug-ins as you might expect. Visit the Avid website ([www.avid.com](http://www.avid.com)) to download the latest versions of corresponding installers included with the version of HD Pack, Massive Pack, Mbox Factory, or 003 Factory that you own. These installers have been updated to run on a Pro Tools 9.0 or higher system (as long as you have valid licences for each plug-in on your iLok).

#### **Pro Tools stops working when opening a session with Structure Free (PTSW-131965)**

When opening a Pro Tools session that uses Structure Free, Pro Tools may hang temporarily if Structure Free is looking for files in a directory where the files are not present.

#### **Pro Tools quits unexpectedly when creating a new folder on the presets page with Hybrid (PTSW-133279)**

When using Hybrid version 1.5.3.10110, Pro Tools may quit unexpectedly when using the New Folder feature on the Presets page. To avoid this problem, update to the latest version of Hybrid.

#### **AudioSuite and Clip Groups (PTSW-57457)**

AudioSuite plug-ins handle Clip Groups in the Clip List slightly differently than audio files. With audio files, an AudioSuite process can be applied to all copies of a unique audio file which appear in your session by selecting your target as Clip List in the AudioSuite plug-in window and selecting Use in Playlist. However, if your target is set to Clip List in the AudioSuite plug-in window while you have a Clip Group selected, Pro Tools does not recognize the Clip Group as processable audio and will present a No Audio was Selected error. This is because a Clip Group is not treated as audio until it is actually used in a track.

#### **To apply an AudioSuite process to all copies of a Clip Group in a session at once, do the following:**

- 1 Select the Clip Group to be processed.
- 2 From the Clip List menu, select Ungroup All. All elements of the group will remain selected.
- 3 Perform AudioSuite processing.
- 4 From the Clip List menu, select Regroup.
- 5 When prompted, select Modify to apply the AudioSuite Process to all copies of the Clip Group in the session, or Copy to apply it only to the selected Clip Group.

### **Plug-in Find and Relink with File Types not Supported by Pro Tools (111704)**

Find and Relink will not be triggered by plug-ins in situations where plug-ins supporting Find and Relink are missing links to file types that are not natively supported by Pro Tools (such as REX files). To have full Plug-in Find and Relink support, the file types used in plug-ins must also be supported by Pro Tools.

### **Software Instrument Does Not Emit Sound when Inserted on an Instrument Track or Auxiliary Input (65797)**

Some older software instruments do not emit sound and/or do not play unless they have a valid hardware input or MIDI output assignment. If this problem occurs, manually assign a hardware input to the Instrument track or Auxiliary Input, and/or manually assign a MIDI output to the Instrument.

### **After Installing Pro Tools 10, Structure Free Appears in the Plug-in Insert Selector Instead of the Full Version of Structure Even Though the Full Version of Structure was Already Installed (PTSW-150093)**

After installing Pro Tools 10 Structure Free appears in the Plug-in Insert selector instead of the full version of Structure even though the full version of Structure was already installed on your computer. To correct this issue, quit Pro Tools, delete the DAE preferences located in /Users/<username>/Library/Preferences/DAE Prefs, and then relaunch Pro Tools.

### **Using the Pro Tools 9.0.5 Uninstaller Also Uninstalls Structure (PTSW-151154)**

When using the Pro Tools 9.0.5 Uninstaller to uninstall Pro Tools 9.x, the Structure plug-in is also uninstalled from your computer. To avoid this issue, do not use the Pro Tools 9.0.5 uninstaller (you do not need to uninstall Pro Tools 9.x before installing Pro Tools 10). If you encounter this issue, you will need to reinstall Structure after you install Pro Tools 10.

## Control Surfaces

### **Trim Scrub and Trim Shuttle Don't Work on Clips with Fades (PTSW-46911)**

If a clip has fades, Trim Scrub and Trim Shuttle don't work when trying to trim using a control surface. To work around this problem, remove any fades on the clip, then execute the Trim Scrub or Trim Shuttle, and then restore the fades.

### **Used HW Output Path Indication (101095)**

In Assign Matrix on your worksurface, Insert mode the used HW output path will not have amber background indicating that it's already assigned after switching to a different insert on the same track.

### **Color Indication on Plug-in Controls in Learn Mode (102710)**

When a plug-in is in Learn mode and the track with this plug-in is not focused on the main ICON unit, all automation LEDs in the Plug-in window will be red if the track is in one of auto write modes. This conflicts with red color indication on the Plug-in control, which is armed for mapping. The workaround is to set the track with plug-ins to Read automation mode.

### **SignalTools Meter Ballistics on Control Surfaces (74340)**

SignalTools RMS, VU, BBC, Nordic and DIN meters will display inaccurate decay times when viewed on a control surface. Unaffected types are Peak, VENUE, and Peak + RMS, which only reports the Peak meter to the control surface. The attack times of the affected meters are not affected, only the decay times. All meter types display accurately in the plug-in window.

### **Channel Strip Plug-in Expander/Gate Meters Appear in the Compressor/Limiter Meter Instead of in the Expander/Gate Meter in D-Control Dynamics Section (Main Unit) (PTSW-150897)**

The Avid Channel Strip plug-in uses shared meters for Expander/Gate and Compressor/Limiter processing. Because of this, both Expander/Gate and Compressor/Limiter metering appear only in the Compressor/Limiter meter in D-Control Dynamics Section (Main Unit).

### **Pro Tools Transport Must Be Stopped when Recalibrating ICON Faders (78074)**

The transport in Pro Tools must be stopped when recalibrating faders on D-Command and D-Control. If one or more faders need calibration do the following: Stop playback, enter Utility mode, press TEST, press FADER, and press RECAL. After recalibrating faders. exit Utility mode.

### **Adjusting Clip Gain with the Jog Wheel on a EUCON Control Surface can Result in Pro Tools Quitting Unexpectedly (PTSW-155028)**

Adjusting Clip Gain using the Jog Wheel on a EUCON control surface during playback can result in Pro Tools quitting unexpectedly. You can avoid this issue by using the mouse or key commands to adjust clip gain instead.

### **The Edit and Mix Window Do Not Follow Banking on EUCON Control Surfaces (PTSW-133466)**

When the Edit Window Follows Bank Selection and/or the Mix Window Follows Bank Selection preferences are enabled in Pro Tools (Setup > Preferences > Mixing), after banking your EUCON controller, neither the Edit nor Mix window scroll to follow. You will have to manually change the view of the Edit or Mix windows to see the tracks that correspond to the EUCON controller if they are off screen.

### **Switching applications in Mac OS X 10.7.x (Lion) while using a EUCON control surface can cause Pro Tools to stop working (PTSW-152800)**

On a system running Mac OS X 10.7.x (Lion) with a EUCON control surface, if you are running other applications with Pro Tools, switching Pro Tools to the frontmost application can cause it to stop working. To prevent this, lock the surface to Pro Tools by doing the following: In the EuControl application, click the Assign tab. Under EuControl Settings, select “Entire Surface” under “Lock to application” and verify that the control surface is locked to Pro Tools.

## Video

### **Playback of QuickTime video in Pro Tools may stutter or drop frames**

When monitoring QuickTime playback in the Pro Tools Video Window on the computer screen, the video image may stutter or drop frames. To improve results with QuickTime playback, try any of the following:

- Disable Continuous Scrolling.
- Close unnecessary UI windows.
- Try using the DNxHD codec.
- If you have an available PCIe slot in your computer, try using one of the following:
  - A supported Blackmagic video card
  - A supported Canopus video peripheral for QuickTime DV playback
- Consider using an Avid option that includes a video solution:
  - The Video Satellite option offers guaranteed performance for Avid video playback (QuickTime can also be used via AMA).
  - The Video Satellite LE option offers a way to integrate a Blackmagic video card into a system
  - The Avid Mojo SDI peripheral offers guaranteed performance for standard-definition Avid video

### **H.264 video files over 2 GB play back incorrectly (PTSW-158646)**

At a certain point during playback, an H.264 video file over 2GB in size will incorrectly restart playback from the beginning, even though the timeline indicates it is not playing from the beginning. The workaround is to place an edit (break) in the video clip prior to the point it starts playing incorrectly from the beginning. This issue only affects H.264 files larger than 2GB.

### **Avid Video Peripherals Are Not Officially Supported with Pro Tools Software (PTSW-132918)**

When using an Avid video peripheral such as Mojo SDI with Pro Tools, you must have Pro Tools|HD or HD Native hardware with a SYNC HD or SYNC IO in order to maintain near sample accurate audio/video sync. Alternately, Pro Tools LE hardware containing an S/PDIF input can be used to resolve the audio clock to the video peripheral. While it is possible to use an Avid video peripheral without the presence of any hardware (Pro Tools Software only), audio/video sync is not guaranteed.

### **Video Offset Affects Bounce To QuickTime Files (PTSW-123033)**

If Pro Tools has a defined Video Offset and you Bounce to QuickTime, the resultant QuickTime file will be offset by the specified amount in Pro Tools (Setup > Video Sync Offset). To avoid this problem, set the Video Sync Offset to 0 before bouncing to the QuickTime file format.



### **QuickTime Movies with a Frame Rate of 29.97 and Greater that Use the Avid DNxHD Codec Do Not Play when Placed at Past 20 Hours Down the Pro Tools Timeline (PTSW-149397)**

With Pro Tools 10, the timeline has increased from 12 hours to 24 hours, allowing any timecode stamped media to be placed at its Original TimeStamp location, regardless of the session start time. However, Avid DNxHD encoded QuickTime clips will not play back when placed anywhere on the Timeline past 20 hours. Please limit use of Avid DNxHD encoded QuickTime clips to the first 20 hours of the Pro Tools Timeline to avoid this issue.

### **When Using Bounce to QuickTime, Do Not Bounce to an Existing Movie Name (PTSW-53967)**

If you use the Bounce to QuickTime command and use the same name as an existing movie, the bounce may fail. It is best to use a unique name for each bounce, or delete the previous movie from the drive prior to bouncing with the same name (rather than choosing to replace the existing file).

### **Pro Tools UI May Slow Down with Densely Edited QuickTime Movie Track (PTSW-54496)**

Pro Tools may begin to respond more slowly and update less often as a session with one or more QuickTime video tracks becomes more and more densely edited. If, while working with heavily edited QuickTime clips, Pro Tools responsiveness begins to decline, use the Bounce to QuickTime Video command, then import the bounced movie.

### **Unsupported QuickTime Video Formats (PTSW-52140, PTSW-52155, PTSW-52156, 72961)**

Several video formats supported in QuickTime are not supported in Pro Tools. These include .DivX, .flc, .m4v and .3gp format movies. Attempting to import these will generate errors or will fail to import.

### **QuickTime Clips with “Clean Aperture” Settings Do Not Play Back in Pro Tools 10 on OS X 10.7 (PTSW-150342)**

Pro Tools 10 on Mac OS X 10.7 is unable to playback QuickTime video clips with “Clean Aperture” settings. The session plays back, but these clips appear black in the Video window. These clips do play back in Pro Tools 10 on Mac OS X 10.6.

### **Standard Definition QuickTime Movies Are Rendered as 16:9 Anamorphic Play Back in Pro Tools at 4:3 (PTSW-23020)**

Standard Definition QuickTime movies rendered with 16:9 anamorphic Scaled Size of 853x480 play back in Pro Tools at 4:3 or 720x486 resolution. The Scaled Size attribute of QuickTime movies is ignored by Pro Tools. To work around this problem, render the movie letterbox natively within the 720x486 pixel dimension.

### **MPEG-1 and MPEG-2 Video Freezes at Edit Points (PTSW-55185)**

Editing MPEG-1 & MPEG-2 video is not officially supported. If you experience this problem, try switching playback to the Video window, or convert the movie to a supported format using a 3rd party application. Removing the audio from an MPEG-1 or MPEG-2 movie with a 3rd party application may also fix the problem.

### **Audio from “Muxed” MPEG-1 and MPEG-2 Movies Cannot Be Imported and Will Be Heard in a Bounced Movie (PTSW-53625)**

Unlike other QuickTime formats, MPEG-1 and MPEG-2 movies store audio and video in a single multiplexed track, called a “muxed.” track. Pro Tools cannot separate the audio from video for these types of movies. As a result, you will not be able to import the audio from an MPEG-1 or MPEG-2 movie. Also, if you Bounce to QuickTime using an MPEG-1 or MPEG-2 movie as a source movie, the original audio from the movie will be present in the bounced movie (even though it will not be heard while working with the movie in Pro Tools). To import audio from an MPEG-1 or MPEG-2 file, use a third party application to “demux” the MPEG stream.

### **Dragging from Mac Finder in Shuffle Mode Does Not Work Correctly with Video (PTSW-28041)**

Dragging a Video file from the desktop to the Edit window while in Shuffle mode will always place the video at session start, overwriting existing video clips in that location.

### **System Instability when Running Multiple Applications Using Blackmagic Design Hardware for QuickTime Video Output (PTSW-19486)**

When Pro Tools is running with a Blackmagic DeckLink II Extreme or Intensity video capture and playback PCI-e card installed, launching Blackmagic Design’s Deck Capture utility, Final Cut Studio, or any other application which supports Black Magic hardware for video output, can result in system instability. To avoid any potential system instability only use one Blackmagic DeckLink-aware application at a time.

**Clip names appear incorrect after selecting Field Recorder channel matches, or expanding to new tracks. (PTSW-136012)**

This can occur if the file name of a Field Recorder channel match contains a hyphen followed by a number greater than zero. Pro Tools names new clips by incrementing the number after the hyphen. If a field recorder file is already named in this way (such as “Filename-01”), then new clips created by selecting a Field Recorder channel match or by expanding a track may have names different from the parent file. To avoid this situation, avoid using hyphens in Field Recorder file names.

**Importing a File Directly to a Field Recorder Guide Track Disables the Field Recorder Guide Track Setting (PTSW-152913)**

Importing an audio file directly to a Field Recorder Guide track, either by dragging from the Workspace browser or dragging from the desktop, will disable the Field Recorder Guide track setting for that track. Once this has occurred, you must re-enable the track as a Field Recorder Guide track. To avoid this issue, import the file to the Clip List first, then drag it to the track. Alternatively, you can use the Import Audio command (File > Import Audio) to import the file to a new track or the Clip List, and then drag it to the desired track.

**Field Recorder Matches Appear Offset After AudioSuite Rendering if the Session Timecode Rate Does not Match the File Timecode Rate (PTSW-152147)**

If a portion of a file has been rendered with an AudioSuite plug-in, an offset can occur when expanding field recorder matches in cases where the session timecode rate does not match the timecode rate of the audio file. To avoid this issue, you can either render the whole file with AudioSuite (rather than only a portion of the file), or use Whole File mode when rendering AudioSuite processing.

## General Localization

**Session Notes or Session Info Text Files Saved in Japanese May Not Open in TextEdit (PTSW-46686)**

Session Notes (you can generate these if you are missing plug-ins or have problems when opening a session) or Session Info (File > Export > Session Info as Text) text files may not open in TextEdit, depending on the TextEdit preference settings. This is because the files use different text encoding. As a workaround, you can use the Console application to open files or you can use the Open menu item in TextEdit, then choose the correct encoding, as follows:

- Session Notes - UTF-8
- Session Info - Japanese (Mac OS)

**Reading Session Notes on Korean Mac OS X (PTSW-144218)**

Apple has changed its default UTF-8 encoding behavior in the latter 10.6.x releases and 10.7.x. Because of this some languages do not open Session Notes correctly in TextEdit.

**To open Session Notes correctly:**

- 1 Launch TextEdit.
- 2 Choose TextEdit > Preferences.
- 3 Click Open and Save.
- 4 Under “Plain Text File Encoding,” set Opening Files to Unicode (UTF-8).

**Certain Chinese Characters Need to Be Initiated in the Mac OS Before They Can Be Used for Naming in Pro Tools (PTSW-33074)**

If you cannot use certain characters for naming in Pro Tools, use Text Edit in Mac OS X to initiate the characters. In Text Edit, type the same characters you were trying to use, then use the mouse to select the correct ones from the pop up menu. You should now be able to use them in Pro Tools.

## **AAF/OMF Sequences with Non-English Characters Import with Garbled Clip Names or Won't Relink (PTSW-33569, PTSW-99570, PTSW-33826)**

If an AAF/OMF sequence containing files or clip names with non-English characters is exported from a Mac-based Pro Tools 7.3.1 system (or lower), it may not import correctly into Avid Media Composer, or Pro Tools 7.4 and higher systems on Windows or Mac. Conversely, AAF/OMF sequences with non-English characters exported from any Pro Tools 7.4 or higher system (or higher) may not import correctly into a Mac-based Pro Tools 7.3.1 (or lower) system. To relink the files, select “Manually Find and Relink,” then deselect all options except “Find by file ID.” Clip names may appear garbled.

---

## **Known Issues with Pro Tools CoreAudio Hardware Drivers**

### **Limitations of the Avid CoreAudio Driver with Digi CoreAudio Manager**

The Digi CoreAudio Driver has the following limitations with HD, 003, and Digi 002 systems:

Pro Tools HD, and Pro Tools with 003 and Digi 002 systems require exclusive access to Pro Tools hardware. You cannot use CoreAudio applications and Pro Tools with these systems at the same time. To use Pro Tools, make sure you quit any CoreAudio applications before launching Pro Tools on these systems. To use a CoreAudio application with these systems, make sure you quit Pro Tools before starting the CoreAudio application.

◆ The Digi CoreAudio Driver cannot be used to preview sound files from the Mac Finder while Pro Tools is running. When a sound file is located in the Mac OS X navigation window, a QuickTime transport bar is displayed next to it. The QuickTime transport bar lets you audition the sound file. With USB audio interfaces, you can preview sound files from the Mac Finder as long as Pro Tools is not running. Regardless, with FireWire and Avid HD audio interfaces, the sound will always play back through the Mac built-in audio controller (through the Mac speaker or headphone jack). However, if you double-click a sound file, the QuickTime application will launch, which can use the Digi CoreAudio Driver for playback.

The Digi CoreAudio Driver cannot be used for playback of Mac System Sounds.

### **Selecting “Digidesign HW” for Sound Input or Output in System Preferences May Cause Pro Tools to Fail to Launch (99576)**

If “Digidesign HW” is selected as the input or output device in System Preferences, certain common actions in the Finder may activate the Digi CoreAudio Manager. These actions include selecting an audio or video file while in Columns view or while the Inspector window is open, or using Get Info or Quick Look on an audio or video file. Once activated, CoreAudio may remain connected even after selecting a different file or closing all Finder windows. If Pro Tools is launched while CoreAudio is connected, an error message stating “Digidesign Hardware is in use by another application. (-1133)” may occur.

### **Pops when Changing Sample Rates**

With the Digi CoreAudio Manager, your Pro Tools hardware may produce a “pop” or “click” sound if Pro Tools was last used at a sample rate different from the one the new CoreAudio client is set to use.

### **Pro Tools Hardware May Not Play Sound from QuickTime or Safari with CoreAudio (PTSW-3093 and PTSW-27892)**

If you do not hear sound when playing back audio through Pro Tools hardware from QuickTime or Safari with the Digi CoreAudio Manager, try one of the following:

- Open the Mac System Preferences and click Sound. While QuickTime or Safari is playing back audio, change the Output from Digidesign HW to Internal, and then back to Digidesign HW.
- or –
- Launch iTunes before launching QuickTime or Safari.

### **Buffer Sizes Incompatible with Pro Tools Hardware (39542)**

In Cubase, Traktor, Live, and certain other applications, you can select Buffer Sizes that may be incompatible with your Pro Tools hardware. Selecting incompatible buffer sizes results in distorted sound and may cause other problems. Please make sure to select Buffer Sizes listed in the following chart:

## Cubase SX Buffer Sizes Supported by Avid Audio Hardware

Avid Audio Hardware	Supported Buffer Sizes
Avid HDX	128, 256, 512, 1024
Pro Tools HD	128, 256, 512, 1024
HD Native	128, 256, 512, 1024
003, 003 Rack, 003 Rack+, Eleven Rack, Digi 002, and Digi 002 Rack	64, 128, 256, 512, 1024
Mbox and Mbox 2-series interfaces	32, 64, 128, 256, 512, 1024

### Reason Output Distorts with Buffer Size Settings Less than 256 Samples, at 88.2 kHz or 96 kHz (39399)

Distorted sound can result when a Reason user has selected a Buffer Size of less than 256 samples at sample rates of 88.2 kHz or 96 kHz.

---

## Known Issues with Audio Interfaces

### HD OMNI

#### Noise in the Output Signal from HD OMNI with Digital Input (PTSW-1614)

If HD OMNI is connected to a digital source with a mismatched clock and Sample Rate Conversion (SRC) is not enabled, you will hear noise (including loud “pops”) in the output signal. To correct this problem, either enable SRC or ensure that the clock of the digital source and HD OMNI are matched correctly.

#### HD OMNI Front Panel SETUP Menus are Unresponsive after Pro Tools Quits Unexpectedly (PTSW-125692)

HD OMNI will not automatically recover “stand-alone” mode if Pro Tools quits unexpectedly (or if you disconnect the DigiLink cable from HD OMNI while Pro Tools is running). As a result, some of the SETUP functions accessible from the front panel will be unavailable. Power cycle HD OMNI to recover stand-alone mode.

#### Graphic Redraw Problems in the Hardware Setup Dialog (PTSW-122690, PTSW-1346, and PTSW-1235)

When changing the Hardware Setup configuration for HD OMNI, it is possible to encounter graphics redraw problems in some cases. To force a graphics redraw of the Hardware Setup dialog, close and reopen the Hardware Setup dialog.

#### Versions of Pro Tools Lower than 8.1 Quit on Launch with HD OMNI (PTSW-1976)

When launching versions of Pro Tools lower than 8.1 with HD OMNI connected and powered on, Pro Tools quits when initializing DSI. To avoid the problem, power off HD OMNI before launching versions of Pro Tools lower than 8.1.

#### No Sound on Output after Hardware RESET (PTSW-126575)

After resetting the HD OMNI interface to the default factory settings using the front panel controls, the HD OMNI interface stops emitting sound in sessions where the outputs are not assigned to the Monitor output path. To correct this problem, press the ALT monitor button to switch to the ALT Monitor path, and then press it again to switch back to the Main Monitor path.

#### Loss of Monitor Path when Launching Pro Tools with HD OMNI Off or Disconnected (PTSW-127313)

When launching Pro Tools and opening I/O Setup after powering off HD OMNI or disconnecting it from the system, the inactive Monitor path is not present in Output tab. You may need to restore the default I/O Settings and remap the corresponding Output Busses.

**Output Paths are not Automatically Created in the Output Page of the I/O Setup After Disabling the Corresponding Monitor Path in the Monitor Page of the Hardware Setup and Re-assigning the Outputs from “None” to Physical Outputs in the Main Page of the Hardware Setup (PTSW-127559)**

After disabling the Monitor path in the Monitor page of the Hardware Setup and re-assigning the corresponding Outputs from “None” to physical outputs (such as “A 1-2”) in the Main Page of the Hardware Setup, these Output paths are not automatically created in the Output Page of the I/O Setup. You will have to manually create the appropriate Output paths in the I/O Setup (or click Default).

**Changing Monitor Path Output Assignments in the Hardware Setup does not Update the Output Paths in the Output Page of the I/O Setup (PTSW-127563)**

When changing Monitor path Output assignments in the Monitor page of the Hardware Setup (such as setting the Monitor path Format to None or assigning the Monitor to different physical outputs), the Output paths in the Output page of the I/O Setup do not reflect the corresponding changes. You will have to manually create the appropriate Output paths in the I/O Setup (or click Default).

**When Creating New Sessions, Using the I/O Settings Selector Can Result in Unexpected Output Assignments if HD OMNI Has an Assigned Monitor Path (PTSW-123896)**

If HD OMNI has an assigned Monitor path, Output paths created by the selected I/O Settings option in the New Session dialog may be offset by the channel width of the Monitor path. If this happens, you will have to manually create the appropriate Output paths in the I/O Setup (or click Default).

**I/O Setup Bus Page Erroneously Adds Monitor Paths (PTSW-127739)**

With both MAIN and ALT Monitor paths declared, toggling one of the CR Monitor paths from the current format to “None” and then back to the starting Monitor format from within the Hardware Setup Monitor page, causes the Bus page in I/O Setup to erroneously add an extra Monitor path with the abbreviation with “(1).” This can happen numerous time and each new Monitor abbreviation increments accordingly.

## 003 Family and 002 Series Interfaces

**Upgrading to Lion can result in the uninstallation of Pro Tools components for Digi 002 and 003 family systems**

If you upgrade from Mac OS X 10.6.x (“Snow Leopard”) to Mac OS X 10.7.x (“Lion”) with Pro Tools already installed, *DigiDioMIDIServer.plugin* and *DigidesignFireWireMIDI.plugin* will be uninstalled during the Lion install. When the OS upgrade is complete, a dialog will appear indicating that these files were moved to an Incompatible Software folder. You can reinstall the drivers for your Digi 002 or 003 family interface after installation to restore these files.

To run Pro Tools on Mac OS X 10.7.x (“Lion”) with a Digi 002 or 003 family interface, Avid recommends that you create a clean Lion partition and install Pro Tools directly to that partition.

**Reconnecting an 003 or 002 After Losing the Connection with Pro Tools (PTSW-20351)**

If your 003 family or 002 series interface loses its connection with Pro Tools, increasing your buffer size or changing your CPU usage limit may bring the device back online without having to close Pro Tools or restart your computer.

**Importing .PIM Files on an 003 System with a C|24 (PTSW-46401)**

When importing a custom map .PIM file created on a 003 to another 003 system with a C|24, 003 displays “<No Track>” on the scribble strips instead of staying in Plug-in Edit mode with a restored newly imported Plug-in Map. You will need to switch to another mode on 003 and then re-enter Plug-in Edit mode to correct this.

## Pro Tools Aggregate I/O (Mac Built-In Audio)

**When using Aggregate I/O on Mac OS 10.7.x (“Lion”), a New Session command results in an error (PTSW-142151) or the Aggregate I/O Sample Rate is frozen at a setting of 0 Hz (PTSW-142166)**

**If either of these errors occurs, do the following:**

- 1 Quit Pro Tools.

- 2 Launch Audio MIDI Setup.
- 3 Choose Window > Show Audio Window.
- 4 Select Pro Tools Aggregate I/O.
- 5 Click the Minus sign icon to delete Aggregate I/O.
- 6 Relaunch Pro Tools.

#### **–6101 Error When Previewing Audio with Pro Tools Aggregate I/O (PTSW-132996)**

When previewing audio in the Import Audio dialog with Pro Tools Aggregate I/O selected as the Current Engine (in the Playback Engine dialog), and with the Mac OS File view is set to Columns view, you may encounter a –6101 error. Try changing the Mac OS file view from Columns to List or Icons view, or use any of the built-in audio devices instead of Pro Tools Aggregate I/O to avoid this problem.

#### **Changing Sample Rates in Audio MIDI Setup can cause Aggregate I/O to Disappear in I/O Setup, Resulting no Audio Output (PTSW-132281)**

When Pro Tools Aggregate I/O is selected as the Current Engine in the Playback Engine dialog, changing sample rates in Audio MIDI Setup can cause the Pro Tools Aggregate I/O to be removed from I/O Setup resulting in no audio output. To correct this problem, click the Default button on the Output page of the I/O Setup.

#### **Error Messages When Opening a Session with a Different Sample Rate from the Aggregate I/O Sample Rate Setting (PTSW-131779)**

Pro Tools may indicate that a given Aggregate I/O device has not automatically adjusted its sample rate when a session with a different sample rate is opened. You may subsequently be presented with a dialog indicating that the session needs to be closed and reopened to update the sample rate setting of the Aggregate I/O device.

#### **Renaming Pro Tools Aggregate I/O driver in AMS Corrupts the Driver (PTSW-131383)**

If you rename the Pro Tools Aggregate I/O driver in Audio MIDI Setup (AMS), the driver be corrupted the next time you launch Pro Tools. If this happens, quit Pro Tools and delete the Pro Tools Aggregate I/O device from AMS. Pro Tools will re-create the driver the next time it is launched.

#### **Pro Tools Quits Unexpectedly when Enabling the Built-In Digital I/O (PTSW-132189)**

When enabling built-in digital I/O for Pro Tools Aggregate I/O in Audio MIDI Setup, Pro Tools quits unexpectedly. To avoid this problem, enable the built-in digital I/O in Audio MIDI Setup before launching Pro Tools.

## Third-Party Core Audio Devices

#### **Pops and Clicks can Occur when Using Third-Party Core Audio Devices with Pro Tools (PTSW-132084)**

Note that audible pops and clicks can occur when using some third-party audio interfaces even if Error Suppression is disabled. Try increasing the Hardware Buffer size for the device to avoid this problem.

#### **Using Low Buffer Sizes with Studio Monitor Express may Result in Pro Tools Quitting Unexpectedly with a Loud Burst of Noise (PTSW-132513)**

Using Studio Monitor Express with some Core Audio Devices may result in Pro Tools quitting unexpectedly along with loud bursts of noise. Studio Monitor Express is *not* recommend for use with Pro Tools at this time.

---

## Error Messages

### **Error –1150 (PTSW-144422)**

When launching Pro Tools HD on HDX hardware, if you encounter a –1150 error, quite Pro Tools, shut down your computer, and ensure that the HDX TDM cable is properly connected.

### **Error –6042**

If you repeatedly encounter –6042 errors, open the System Usage window and check the PCI gauge. If the gauge is peaked, you will need to reset the PCI bus. To reset the PCI bus, make all tracks inactive and start playback. If you still encounter a –6042 error, quit and relaunch Pro Tools, open the Playback Engine dialog, and change the Number of Voices setting to use fewer voices per DSP.

### **Error –9073 Without Reaching the 2 GB File Limit**

If you encounter a –9073 error, and you have not reached the 2 GB file size limit, please refer to the Knowledge Base for possible causes and solutions ([www.avid.com/onlinesupport](http://www.avid.com/onlinesupport)).

### **Error –9092**

When using MachineControl to control a 9-pin device, you may encounter a –9092 error if the machine is cued to a point before session start. Adjust session start of sessions used with the 9-pin client to accommodate the necessary pre-roll for transport lock.

### **Error –9128**

In sessions with high sample rates (96 kHz or higher), you may need to set the Hardware Buffer Size to 512 or more to avoid –9128 errors during playback with Native (RTAS and AAX) plug-ins or dense automation.

### **Error –9131 (92747, 20843)**

GUID partitioned drives will not allow you to record beyond the third partition when running on OS X. A workaround is to partition audio drives using Apple Partition Map instead of GUID.

– or –

Recording to or playing from a UNIX File System (UFS) formatted drive is not supported in Pro Tools.

### **Error –9132 (32397)**

If a –9132 error occurs during Bounce To Disk (even with the highest Hardware Buffer setting selected), bus the appropriate tracks to the appropriate number and format of audio tracks, and record to disk. You can then use the resulting audio files as you would have used bounced files.

### **Error –9155**

In sessions with high sample rates of 96 kHz or more, you may need to set the Hardware Buffer Size to 512 or more to avoid –9155 errors during playback with dense automation.