

## **Pro Tools HD 7.3.1cs8 Update for Mac OS X (Tiger)**

January 16, 2009 — Read Me Document (Included with Download)

### **For Pro Tools|HD Systems with Pro Tools HD 7.3 or 7.3.1 for Mac OS X "Tiger" Only**

- Universal installer for PowerPC and Intel-based Macs
- This update requires previous installation of Pro Tools HD 7.3 or 7.3.1
- *Please Note: If you are on 7.3, it is not necessary to update to 7.3.1 to use this update*

### **Who Should Use Pro Tools HD 7.3.1cs8?**

This update is recommended for all Pro Tools HD 7.3 or 7.3.1 users.

### **Pro Tools HD 7.3.1cs8 contains fixes in the following area:**

- Pro Tools application launch

*Plus previous fixes in the following areas:*

- Automation
- Digidesign Control Surfaces:
  - Command|8
  - Control|24
  - D-Control
  - D-Command
  - ProControl
- Dynamics III
- Editing
- Mixing
- Graphic updating
- Using "Bounce To Disk"
- Importing audio files from field recorders
- Importing OMFs
- Using DestructivePunch
- Customers using Gallery's ADRStudio
- Recording and editing
- Playing and recording
- Mojo SDI\*
- Digitizing using Mojo or Mojo SDI (PowerPC-based Macs only; Support for Avid video peripherals on Intel-based Macs requires Pro Tools HD 7.4 software.)
- Mac Pro (Pro Tools HD 7.3.1cs3 or higher *required* for 2007 8-Core Mac Pro; 2008 Mac Pro not qualified with Tiger)
- DigiBase preview
- Sends
- Logic Pro DAE configuration (PowerPC-based Macs only)

### **Plus these important fixes from Pro Tools HD 7.3.1, required to avoid potential data loss:**

- Editing
- Bounce to QuickTime movie

- Memory Locations
- CoreAudio

*Pro Tools HD 7.3.1cs8 is provided as an interim "customer support (CS)" release to address the issues described. While our testing has not shown these changes to introduce other problems, this version has not been fully qualified by Digidesign.*

### **What's Fixed in Pro Tools HD 7.3.1cs8?**

Pro Tools HD 7.3.1cs8 for Mac OS X contains the following:

#### **Fixed: Pro Tools 7.3.1 will no longer launch after installing Apple Security Update 2008-008 (Item #112749)**

- After installing Apple Security Update 2008-008 for Mac OS X 10.4.11 (released December 15, 2008), the Pro Tools icon would bounce in the Dock but the application would not launch.

*Fixes Included from Pro Tools HD 7.3.1cs7:*

#### **Fixed: Pro Tools Automation Thinning Could Sometimes Remove Non-Redundant Breakpoints (Item #100794)**

- The thinning algorithm could mistakenly classify a breakpoint as redundant

#### **Fixed: Playback of Surround Panning automation gets "stuck" (Item #100847)**

- This would only occur when writing automation with a selection highlighted while in Loop Playback mode

#### **Fixed: Trim Values Could Be Accidentally Written To The Entire Session (Item #100795)**

- Steps to reproduce:
  - A fader position in Latch/Trim or Touch Trim could be accidentally bumped while the transport was stopped.
  - Subsequently leaving Trim mode, or manually coalescing trims would then write that bumped value to the entire track

*Fixes Included from Pro Tools HD 7.3.1cs6:*

#### **Fixed: On D-Control and D-Command, the Touch Command Would Sometimes Not Engage When Quickly Grabbing a Fader (Item #87718)**

- The fader would "push back" and no automation would be written

#### **Fixed: Pro Tools quits unexpectedly when moving a plug-in window while closing it from a control surface (Item #99442)**

- If a plug-in window was closed from a control surface while the plug-in window was being dragged across the screen, Pro Tools would quit unexpectedly.

#### **Fixed: Opening a Session with an RTAS Version of Dynamics III Could Result in a Burst of Noise (Item #99562)**

- This problem was intermittent, and would not occur when using TDM versions of Dynamics III

#### **Fixed: Surround Pan Automation is not Updating Properly in Loop Playback (Item # 85802)**

- The pan positions are correct on the first play of the selection, but can be incorrect on subsequent plays
- Please note that there is still an outstanding issue where Surround Pan automation may stick on a particular output. Digidesign is currently working on a solution.

*Fixes Included from Pro Tools HD 7.3.1cs5:*

#### **Fixed: In Some Circumstances, a Trim Edit Could Not Be Constrained (Item #94425)**

- The "constrain" command (Control+Trimmer) would not work under certain editing situations involving overlap/underlap.

**Fixed: Closing and Reopening Session Could Toggle The Inactive/Active State Of Some Sends (Item #97716)**

- This only would occur with Delay Compensation disabled

**Fixed: Send Outputs Would Intermittently Stop Routing Audio (Item #88757)**

- The workaround was to shuffle paths in the I/O Setup, use another bus path, or reopen the session.

**Fixed: Regions Could Disappear From a Session After Neo Assertion Errors (Item #97360)**

- In some cases, having to force quit after getting Neo Assertion errors could cause all regions to be removed from a session.

**Fixed: Intermittent Graphic Freeze When Using Pro Tools (Item #82932)**

- Pro Tools would continue to play while the GUI was frozen, with intermittent plug-in automation and MIDI playback, and then unfreeze.

*Fixes Included from Pro Tools HD 7.3.1cs4:*

**Fixed: Dither Was Incorrectly Being Applied During "Bounce To Disk" Operations (Item #94510)**

**Fixed - Importing Audio Files From A Sound Devices 744T Field Recorder Caused Time Stamp information to be inaccurately displayed in the Spot dialog (Item #90820)**

- Note that the Workspace/Project browser displayed the correct time stamp information.

**Fixed: Random Crashes When Using DestructivePunch (Item #94441)**

- A restart was forced after these errors
- Errors included -9161, -9162, -6034, -6039, and "unable to communicate with audio hardware."

**Fixed: An OMF Generated From Smoke Could Not Be Imported Into Pro Tools (Item #93481)**

**Fixed: Reliability of Gallery's ADRStudio Was Affected By a Change In Pro Tools 7.2 (Item #92013)**

- ADRStudio's time code entry capability was affected.

*Fixes Included from Pro Tools HD 7.3.1cs3:*

**Fixed: Random Disappearance or Corruption of Regions On Tracks When Editing Or Punching In (Item #85976)**

- Although this could occur while editing or recording over regions, the problem was most evident when QuickPunching over existing regions.

**Fixed: Importing Audio Files From A Sound Devices 744T Field Recorder Causes Multiple Problems (Item #90570, 90726)**

- Audio files would not have a Unique ID assigned to them
- An assertion, "FF AudioProperty.cpp, line 33" would be thrown when overviews were being calculated
- Audio could be unreadable by Pro Tools

*Note: The following problem has not yet been addressed. We expect this fix in a future version of Pro Tools:*

- Pro Tools cannot access the time stamp information in Spot mode

**Fixed: Attempting To Play From The Beginning Of A Session May Fail (Item #85674, 93283, 93289)**

- After the play command, the Play and Stop buttons flash, but Pro Tools does not play.
- Repeated attempts may result in a successful play
- *Note: Pro Tools 7.3.1cs8 fixes some, but not all occurrences of this issue. Digidesign will continue to investigate additional fixes for this issue.*

**Fixed: Mojo SDI Could Not Directly Resolve To PAL Black (Item #90821)**

- Note that Mojo SDI would switch to "internal sync" when changing the video format in Pro Tools

**Fixed: Error: "Digitize Aborted Due to Dropped Frames" When Digitizing to Mojo or Mojo SDI (Item #91345)**

- *Note: The fix covers most, but not all cases of this bug*
- PCI-x Power Mac G5 models are more likely to experience failures than PCIe (PCI Express) Power Mac G5 models.

**Fixed: DAE Error -6042 During Record Could Result When Using a Mac Pro (Item #92185)**

- This could occur using HD1 or HD2 when recording a very high number of tracks

*Fixes Included from Pro Tools HD 7.3.1cs2:*

**Fixed: Previewing Audio in the Workspace Could Cause an Assertion Error (Item #87627)**

- This would occur if the previewed audio was the result of a search. Note that clicking on the waveform was not problematic.

**Fixed: ICON Faders Can Become Offset From the Pro Tools Level (Item #87717)**

- This could occur if the fader was moved without receiving a "touch on" and then touched properly.
- **Please Note:** *After installing Pro Tools 7.3.1cs8, the user must un-declare, then re-declare the ICON main units and fader packs to prompt the firmware update dialog. If the ICON firmware is not updated, the fix will not be installed.*

*Fixes Included from Pro Tools HD 7.3.1cs1:*

**Fixed: Adjusting Send Levels While Recording Audio Can Result in the Send Levels Resetting to "0" When Reopening The Session (Item #86186)**

- This would occur if no automation had been written on the Send.

**Fixed: Disabling "Auto Input Monitoring" on Logic Pro 7.2.x with DAE Results in Random Error Messages (Item #85250)**

- This problem does not occur with "Auto Input Monitoring" enabled
- *Note: Logic Pro DAE configuration is only available with Logic Pro on PowerPC-based Macs. Logic Pro DAE configuration on Intel-based Macs is not yet available.*

**Fixes Included from Pro Tools HD 7.3.1**

**Fixed: Intermittent Corruption After Saving, Closing, and Then Reopening a Session, Regions Were Missing or in the Wrong Location on the Timeline (Item #85755)**

- As long as the session remained open, it would still playback correctly and with all playlists intact. The problem would not be observed until the session was closed and reopened.
- Any AutoBackup files created would have the same problem when subsequently opened.

**Fixed: Bouncing to QuickTime Movie Could Produce a File Where Audio and Video Were Out of Sync (Item #85906)**

- If the bounce duration exceeded the length of the video clip, the resulting movie would be stretched to fit the selection, resulting in a time-stretched picture.

**Fixed: Performing "Undo Add Memory Location" or "Undo Edit Memory Location" Would**

## **Cause a Crash (Item #84814)**

**Fixed: On Intel-Based Macs, Snaps and Distortion Could Result When Using CoreAudio (Item #83316)**

## **Updating Pro Tools**

To update to Pro Tools HD 7.3.1cs8:

1. Verify Pro Tools HD 7.3 or 7.3.1 is installed on your system
2. Quit the Pro Tools application if it is open
3. Locate the Pro Tools HD 7.3.1cs8 installer and launch it
4. Follow the onscreen instructions to install Pro Tools HD 7.3.1cs8
5. When installation is complete, restart your computer

If you have installed previous updates, some file versions may not change. This update installs the following files:

- Pro Tools HD.app (v7.3.1cs8)
- Dynamics III.dpm (v7.3.1cs6)
- D-Command.bundle (v7.3.1cs6)
- D-Control.bundle (v7.3.1cs6)
- DFW.framework (v7.3.1cs5)
- Surround Mixer.dpm (v7.3.1cs5)
- Stereo Mixer.dpm (v7.3.1cs5)
- Surround Dithered Mixer.dpm (v7.3.1cs5)
- Stereo Dithered Mixer.dpm (v7.3.1cs5)
- Command8.bundle (v7.3.1cs4)
- Control24.bundle (v7.3.1cs4)
- EditPack.bundle (v7.3.1cs4)
- HUI-MotorMix.bundle (v7.3.1cs4)
- ProControl.bundle (v7.3.1cs4)
- ProControl\_M.bundle (v7.3.1cs4)
- SurroundPanner.bundle (v7.3.1cs4)
- FFmt.framework (v7.3.1cs4)
- DAE.framework (v7.3.1cs4)
- DirectIO.framework (v7.3.1cs4)
- VeDioIF.framework (v7.3.1cs3)
- VideoEngineDIO.bundle (v7.3.1cs3)
- Digi CoreAudio Manager.app (v7.3cs1)
- Digidesign CoreAudio.plugin (v7.3cs1)